

### **Public Buildings Enhanced Energy Efficiency Program**

### Final Report Investigation Results For Elmer Andersen Human Services Building



Date: 5/31/2012



#### **Table of Contents**

Investigation Report	Section 1
Elmer Andersen Human Services Building Investigation Overview	
Summary Tables	2
Facility Overview	
Summary of Findings	Section 2
Findings Summary	(1 pages)
Investigation Checklist Summary	(3 pages)
Glossary	(4 pages)
Findings Details	Section 3
Findings Details	(8 pages)
Deleted Findings	(3 pages)
Screening Report	Section 4


This Documentation is owned and copyrighted by Center for Energy and Environment Copyright @ 2011 All Rights Reserved.



#### Elmer Andersen Human Services Building Energy Investigation Overview

The goal of a PBEEEP Energy Investigation is to identify energy savings opportunities with a payback of fifteen years or less. Particular emphasis is on finding those opportunities that will generate savings with a relatively fast (1 to 5 years) and certain payback. During the investigation phase the provider conducts a rigorous analysis of the building operations. Through observation, targeted functional testing, and analysis of extensive trend and portable logger data, the RCx Provider identifies deficiencies in the operation of the mechanical equipment, lighting, envelope, and related controls. The investigation of Elmer Andersen Human Services Building was performed by Sebesta Blomberg, Inc. This report is the result of that information.

Payback Information and Energy Savings					
Total project costs (Without Co-f	unding)		Project costs with Co-fundin	g	
Total costs to date including study	\$76,401		Total Project Cost	\$151,891	
Future costs including Implementation, Measurement & Verification	\$75,940		Study and Administrative Cost Paid with ARRA Funds	(\$79,401)	
Total Project Cost	\$151,891		Utility Co-funding	\$	
			Total costs after co-funding	\$71,940	
Estimated Annual Total Savings (\$)	\$25,017		Estimated Annual Total Savings (\$) Total Project Payback	\$25,017	
Total Project Payback	6.1		with co-funding	3.0	
<b>Electric Energy Savings</b>	10.4%	and	District Energy Savings	2.7 %	

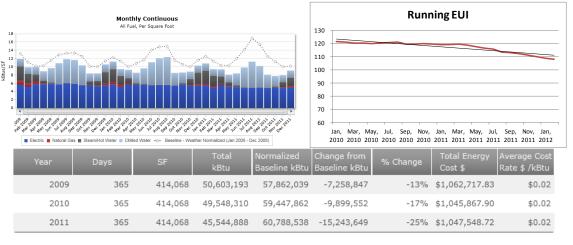

Elmer Andersen Human Services Building Consumption Report Total energy use decreased 11% during the period of the investigation



STATE OF MINNESOTA B3 BENCHMARKING



#### **Summary Tables**

Elmer Andersen Human Services Building				
Location	540 Cedar Street, St Paul, MN 55155			
Facility Manager	Gene Peterman			
Interior Square Footage	414,068			
PBEEEP Provider	Sebesta Blomberg, Inc.			
State's Project Manager	Harvey Jaeger			
Annual Energy Cost	\$ 1,047,549 (2011) Source: B3			
Utility Company	Xcel Energy (Electric) St Paul District Energy (Steam & Chilled Water)			
Site Energy Use Index (EUI)	120 kBtu/ft <sup>2</sup> (at start of study) 107 kBtu/ft <sup>2</sup> (at end of study)			
Benchmark EUI (from B3)	113 kBtu/ft <sup>2</sup>			

Building Name	State ID	Square Footage	Year Built
Elmer Andersen Human	G02310273	414,068	2005

	Mechanical Equipment Summary Table
Quantity	Equipment Description
1	Honeywell EBI Automation System
10	Air Handlers
112	VAV Boxes
294	Fan-Powered VAV Boxes
13	Fan Coil Units
12	Computer Room Air Conditioning (CRAC) Units
25	Cabinet Unit Heaters and Unit Heaters
2	Steam Boilers
1	Back-up Generator





Implementation Information					
Estimated Annual Total	Savings (\$)		\$25,017		
Total Estimated Implen	nentation Cost (\$)		\$71,940		
GHG Avoided in U.S T	ons (CO2e)		233		
Electric Energy Savings	s (kWh)	10.4 % Savings			
2011 Electric Usage 2,2	214,850 kWh (fro	m B3)	230,054		
Electric Demand Saving	gs (Peak kW)		0		
District Hot Water Savi	ngs (MMBtu)	1.8 % Savings			
2011 Usage 5,199 MM	Btu from B3	-	92		
District Chilled Water Savings (MMBtu) 3.1 % Savings					
2011 Usage 14,555 MMBtu from B3			450		
Statistics					
Number of Measures id	7				
Number of Measures w	Number of Measures with payback < 3				
years			2		
		Screening End			
Screening Start Date 5/4/2010 Date		6/9/2010			
Investigation Start Investigation End					
Date	10/15/2010	Date	4/30/2012		
Final Report	5/31//2012				

Elmer Andersen Human Services Building Cost Information					
Phase	To date	Estimated			
Screening	\$3,753				
Investigation [Provider]	\$65,800				
Investigation [CEE]	\$6,848	\$1,000			
Implementation		\$71,940			
Implementation [CEE]		\$1,000			
Measurement &					
Verification	0	\$1,000			
Total	\$76,401	\$74,940			

Co-funding Summary			
Study and Administrative Cost	\$79,401		
Utility Co-Funding - Estimated Total (\$)	\$		
Total Co-funding (\$)	\$79,401		



#### **Facility Overview**

The energy investigation identified 4.7% of total energy savings at Elmer Andersen Human Services Building with measures that payback in less than 15 years and do not adversely affect occupant comfort. The energy savings opportunities identified at Elmer Andersen Human Services Building are based on adjusting the schedule of equipment to match actual building occupancy hours, adjusting control points for fan powered VAV boxes, correcting economizer operation and adjusting the underfloor air distribution system to maintain the duct static set point. The total cost of implementing all the measures is \$71,940.

Implementing all these measures can save the facility approximately \$25,017 a year with a combined payback period of 2.9 years before rebates based on the implementation cost only (excluding study and administrative costs). These measures will produce 10.4 % electrical savings and 1.8 % hot water savings and 3.1 % chilled water savings. The building is currently performing at 5% below the Minnesota Benchmarking and Beyond database (B3) benchmark; energy usage during the period of the study declined by 11%.

The primary energy intensive systems at Elmer Andersen Human Services Building are described here:

The Andersen Office Building is one large detached building consisting of 395,752 interior square feet. The building has nine stories above ground and one below. The conditioned spaces are primarily offices and there is a data center on the basement level. Levels 5 and 6 and Levels 7 and 8 have open staircases between them while the rest of the floors are closed off to one another. The building has an attached seven story unconditioned parking ramp. The building was constructed in 2005 and was commissioned at the time of construction.

#### Controls and Automation System

The building runs on a Honeywell EBI R310.1 automation system, which is part of the State Capitol Complex system. All equipment is DDC and all equipment is on the automation system except several Cabinet Unit Heaters, Unit Heaters, and pumps. There are a total of approximately 300 points on the automation system.

#### Primary Energy Sources

The building uses chilled and hot water from District Energy St. Paul. Some of the District chilled water is routed directly to the air handling units (AHUs) and some is run through heat exchangers that send chilled water to Computer Room Air Conditioning (CRAC) units in the data center. The District hot water is run through heat exchangers and the hot water is sent to the air handlers and terminal equipment. There are two natural gas steam boilers that are used solely for humidification in the air handlers.



#### Mechanical Equipment

There are a total of ten AHUs serving the Andersen Office Building. Nine of the AHUs are located in the Penthouse (Level 9) and are variable air volume units with VAV boxes and/or Fan-Powered VAV (FPVAV) boxes. There is one constant volume air handler located on the first floor (Level 1) that serves the loading dock area. Levels 0 (the below ground level) and 1 have VAV boxes in the ceiling plenums. Levels 2-8 have underfloor supply plenums with perimeter FPVAVs. There are round floor diffusers that can be adjusted to supply varying amounts of air to the spaces directly from the underfloor supply plenum. There are also FPVAVs on these floors that are ducted to diffusers along the exterior walls. The FPVAVs take air from the underfloor supply plenum and heat it as needed based on thermostats along the exterior walls. The occupants have no control over the space temperature except for adjusting the amount of air coming out of the round floor diffusers. Level 9 is the Penthouse and is heated by eleven fan coil units.

#### Metering

There is one natural gas meter, three electric meters (one dedicated to the data center), two District Energy (St. Paul) meters (one for chilled water and one for hot water), and one fuel oil meter. Fuel oil is used only by the back-up generator.





# **Findings Summary**

### Site: Elmer Anderson

Eco #	Building	Investigation Finding	Total Cost	Savings	Payback	Co- Funding	Payback Co-Funding	GHG
5	Elmer Anderson Office Building	AHU-3 Operates 24/7	\$3,630	\$6,377	0.57	\$0	0.57	66
7	Elmer Anderson Office Building	Fan Powered VAV minimum CFM setpoints are the same as the maximums.	\$11,660	\$7,138	1.63	\$0	1.63	104
8	Elmer Anderson Office Building	Building Chilled water pump operating during outside air conditions below 55F.	\$1,540	\$492	3.13	\$0	3.13	7
9	Elmer Anderson Office Building	Space heating is excessive.	\$3,080	\$954	3.23	\$0	3.23	3
2	Elmer Anderson Office Building	AHU Economizers not functioning as designed.	\$27,500	\$7,249	3.79	\$0	3.79	22
4	Elmer Anderson Office Building	Toilet exhaust fan operates beyond normal hours of occupancy.	\$880	\$135	6.53	\$0	6.53	2
1	Elmer Anderson Office Building	AHU Supply Fan not maintaining duct static pressure setpoint.	\$23,650	\$2,673	8.85	\$0	8.85	29
		Total for Findings with Payback 3 years or less:	\$15,290	\$13,515	1.13	\$0	1.13	169
		Total for all Findings:	\$71,940	\$25,017	2.88	\$0	2.88	233





#### Elmer Andersen Building

Finding Type Number	Finding Type	Relevant Findings (if any)	Lookea for, Not found	Not relevant
a.1 (1)	Time of Day enabling is excessive	1		
a.2 (2)	Equipment is enabled regardless of need, or such enabling is excessive	1		
a.3 (3)	Lighting is on more hours than necessary.		1	
a.4 (4)	OTHER_Equipment Scheduling/Enabling	1		
b.1 (5)	Economizer Operation – Inadequate Free Cooling (Damper failed in minimum or closed position,	2		
b.2 (6)	Over-Ventilation – Outside air damper failed in an open position. Minimum outside air fraction not set	2		
b.3 (7)	OTHER Economizer/OA Loads		1	
c.1 (8)	Simultaneous Heating and Cooling is present and excessive	3		
c.2 (9)	Sensor/Thermostat needs calibration, relocation/shielding, and/or replacement	1		
c.3 (10)	Controls "hunt" and/or need Loop Tuning or separation of heating/cooling setpoints		1	
c.4 (11)	OTHER_Controls	1		
d.1 (12)	Daylighting controls or occupancy sensors need optimization.		1	
d.2 (13)	Zone setpoint setup/setback are not implemented or are sub-optimal.	9		
d.3 (14)	Fan Speed Doesn't Vary Sufficiently	1		
d.4 (15)	Pump Speed Doesn't Vary Sufficiently		1	
d.5 (16)	VAV Box Minimum Flow Setpoint is higher than necessary	7		
d.6 (17)	Other_Controls (Setpoint Changes)	2		
e.1 (18)	HW Supply Temperature Reset is not implemented or is sub-optimal		1	
e.2 (19)	CHW Supply Temperature Reset is not implemented or is sub-optimal		1	

e.3 (20)	Supply Air Temperature Reset is not implemented or is sub-optimal			
e.4()	Supply Duct Static Pressure Reset is not		1	
	implemented or is sub-optimal Condenser Water Temperature Reset is not	1		
e.5 (21)	implemented or is sub-optimal		1	_
e.6 (22)	Other_Controls (Reset Schedules)		1	on looked for, but did
f.1 (23)	Daylighting Control needs optimization—Spaces are Over-Lit		1	on looked for, but did
f.2 (24)	Pump Discharge Throttled			1
f.3 (25)	Over-Pumping	8		
f.4 (26)	Equipment is oversized for load.		1	
f.5 (27)	OTHER Equipment Efficiency/Load Reduction		1	
g.1 (28)	VFD Retrofit - Fans			1
g.2 (29)	VFD Retrofit - Pumps			1
g.3 (30)	VFD Retrofit - Motors (process)			1
g.4 (31)	OTHER_VFD			1
h.1 (32)	Retrofit - Motors			1
h.2 (33)	Retrofit - Chillers			1
h.3 (34)	Retrofit - Air Conditioners (Air Handling Units, Packaged Unitary Equipment)			1
h.4 (35)	Retrofit - Boilers			1
h.5 (36)	Retrofit - Packaged Gas fired heating			1
h.6 (37)	Retrofit - Heat Pumps			1
h.7 (38)	Retrofit - Equipment (custom)			1
h.8 (39)	Retrofit - Pumping distribution method		1	
h.9 (40)	Retrofit - Energy/Heat Recovery			1
h.10 (41)	Retrofit - System (custom)			1
h.11 (42)	Retrofit - Efficient Lighting		1	

h.12 (43)	Retrofit - Building Envelope		1
h.13 (44)	Retrofit - Alternative Energy		1
h.14 (45)	OTHER_Retrofit		
i.1 (46)	Differed Maintenance from Recommended/Standard	1	
i.2 (47)	Impurity/Contamination	1	
i.3 ( )	Leaky/Stuck Damper	1	
i.4 ( )	Leaky/Stuck Valve	1	
i.5 (48)	OTHER_Maintenance	1	
j.1 (49)	<u>OTHER</u>		

### **Findings Glossary: Findings Examples**

a.1 (1)	Time of Day enabling is excessive					
	HVAC running when building is unoccupied. Equipment schedule doesn't follow building occupancy					
	Optimum start-stop is not implemented					
	Controls in hand					
a.2 (2)	Equipment is enabled regardless of need, or such enabling is excessive					
	• Fan runs at 2" static pressure. Lowering pressure to 1.8" does not create comfort problem and the					
	flow is per design.					
	Supply air temperature and pressure reset: cooling and heating					
a.3 (3)	Lighting is on more hours than necessary					
	Lighting is on at night when the building is unoccupied					
	Photocells could be used to control exterior lighting					
- 4 /4\	Lighting controls not calibrated/adjusted properly  OTUED Faviors and Sahaduling and Facilities.					
a.4 (4)	OTHER Equipment Scheduling and Enabling					
L 4 /E\	Please contact PBEEEP Project Engineer for approval      The second					
b.1 (5)	Economizer Operation – Inadequate Free Cooling					
	Economizer is locked out whenever mechanical cooling is enabled (non-integrated economizer)					
	Economizer linkage is broken     Economizer setneints could be entimized.					
	Economizer setpoints could be optimized     Playand used as the outdoor air control					
	<ul><li>Plywood used as the outdoor air control</li><li>Damper failed in minimum or closed position</li></ul>					
I- 2 (c)						
b.2 (6)	Over-Ventilation					
	Demand-based ventilation control has been disabled     Outside six demand falled in an expense a sixting.					
	Outside air damper failed in an open position     Minimum autside air fraction not set to design specifications or assumence.					
L 2 /3\	Minimum outside air fraction not set to design specifications or occupancy  OTUD France (Outside Air London)  OTUD France (Outside Air London)					
b.3 (7)	OTHER Economizer/Outside Air Loads					
- 1 (0)	Please contact PBEEEP Project Engineer for approval  Simultaneous Meeting and Gooling is present and approval.					
c.1 (8)	Simultaneous Heating and Cooling is present and excessive					
	For a given zone, CHW and HW systems are unnecessarily on and running simultaneously      Different categories are used for two purposes against a second for two purposes.					
- 2 (0)	Different setpoints are used for two systems serving a common zone  Severy / The green state product a children and / or and occurrent.					
c.2 (9)	Sensor / Thermostat needs calibration, relocation / shielding, and/or replacement					
	<ul> <li>OAT temperature is reading 5 degrees high, resulting in loss of useful economizer operation</li> <li>Zone sensors need to be relocated after tenant improvements</li> </ul>					
	OAT sensor reads high in sunlight					
- 2 /10\						
c.3 (10)	Controls "hunt" / need Loop Tuning or separation of heating/cooling setpoints					
	CHW valve cycles open and closed  Civitary people lead typing this gualing between besting and cooling.					
- 4 (11)	System needs loop tuning – it is cycling between heating and cooling  OTHER Controls					
c.4 (11)	Please contact PBEEEP Project Engineer for approval					
d 1 /12\	Daylighting controls or occupancy sensors need optimization					
d.1 (12)	Existing controls are not functioning or overridden					
	Light sensors improperly placed or out of calibration					
d.2 (13)	Zone setpoint setup / setback are not implemented or are sub-optimal					
u.2 (13)	• The cooling setpoint is 74 °F 24 hours per day					
4 2 (14)						
d.3 (14)	Fan Speed Doesn't Vary Sufficiently					
	• Fan runs at 2" static pressure. Lowering pressure to 1.8" does not create comfort problem and the					
	flow is per design.					
	Supply air temperature and pressure reset: cooling and heating					

d.4 (15)	Pump Speed Doesn't Vary Sufficiently				
	• Pump runs at 15 PSI on peak day. Lowering pressure to 12 does not create comfort problem and the flow is per design. Low ΔT across the chiller during low load conditions.				
d.5 (16)	VAV Box Minimum Flow Setpoint is higher than necessary				
	Boxes universally set at 40%, regardless of occupancy. Most boxes can have setpoints lowered and still meet minimum airflow requirements.				
d.6 (17)	Other Controls (Setpoint Changes)				
	Please contact PBEEEP Project Engineer for approval				
e.1 (18)	HW Supply Temperature Reset is not implemented or is sub-optimal				
	<ul> <li>HW supply temperature is a constant 180 °F. It should be reset based on demand, or decreased by a reset schedule as OAT increases.</li> <li>DHW Setpoints are constant 24 hours per day</li> </ul>				
e.2 (19)	CHW Supply Temperature Reset is not implemented or is sub-optimal				
	• CHW supply temperature is a constant 42 °F. It could be reset, based on demand or ambient temperature.				
e.3 (20)	Supply Air Temperature Reset is not implemented or is sub-optimal				
	• The SAT is constant at 55 °F. It could be reset to minimize reheat and maximize economizer cooling. The reset should ideally be based on demand (e.g., looking at zone box damper positions), but could also be reset based on OAT.				
e.4()	Supply Duct Static Pressure Reset is not implemented or is suboptimal				
	• The Duct Static Pressure (DSP) is constant at 1.5" wc. It could be reset to minimize fan energy. The reset should ideally be based on demand (e.g. looking at zone box damper positions), but could also be reset based on OAT.				
e.5 (21)	Condenser Water Temperature Reset is not implemented or is sub-optimal				
	• CW temperature is constant leaving the tower at 85 °F. The temperature should be reduced to minimize the total energy use of the chiller and tower. It may be worthwhile to reset based on load and ambient conditions.				
e.6 (22)	Other Controls (Reset Schedules)				
	Please contact PBEEEP Project Engineer for approval				
f.1 (23)	Lighting system needs optimization - Spaces are overlit				
	Lighting exceeds ASHRAE or IES standard levels for specific space types or tasks				
f.2 (24)	Pump Discharge Throttled				
	• The discharge valve for the CHW pump is 30% open. The valve should be opened and the impeller size reduced to provide the proper flow without throttling.				
f.3 (25)	Over-Pumping				
	Only one CHW pump runs when one chiller is running. However, due to the reduced pressure drop in the common piping, the pump is providing much greater flow than needed.				
f.4 (26)	Equipment is oversized for load				
	<ul><li> The equipment cycles unnecessarily</li><li> The peak load is much less than the installed equipment capacity</li></ul>				

f.5 (27)	OTHER Equipment Efficiency/Load Reduction					
	Please contact PBEEEP Project Engineer for approval					
g.1 (28)	VFD Retrofit Fans					
	• Fan serves variable flow system, but does not have a VFD.					
	VFD is in override mode, and was found to be not modulating.					
g.2 (29)	VFD Retrofit - Pumps					
	<ul> <li>3-way valves are used to maintain constant flow during low load periods.</li> <li>Only one CHW pumps runs when one chiller is running. However, due to the reduced pressure drop in the common piping, the pump is providing much greater flow than needed.</li> </ul>					
g.3 (30)	VFD Retrofit - Motors (process)					
	Motor is constant speed and uses a variable pitch sheave to obtain speed control.					
g.4 (31)	OTHER VFD					
	Please contact PBEEEP Project Engineer for approval					
h.1 (32)	Retrofit - Motors					
	Efficiency of installed motor is much lower than efficiency of currently available motors					
h.2 (33)	Retrofit - Chillers					
	Efficiency of installed chiller is much lower than efficiency of currently available chillers					
h.3 (34)	Retrofit - Air Conditioners (Air Handling Units, Packaged Unitary Equipment)					
	Efficiency of installed air conditioner is much lower than efficiency of currently available air conditioners					
h.4 (35)	Retrofit - Boilers					
	Efficiency of installed boiler is much lower than efficiency of currently available boilers					
h.5 (36)	Retrofit - Packaged Gas-fired heating					
	Efficiency of installed heaters is much lower than efficiency of currently available heaters					
h.6 (37)	Retrofit - Heat Pumps					
	Efficiency of installed heat pump is much lower than efficiency of currently available heat pumps					
h.7 (38)	Retrofit - Equipment (custom)					
	Efficiency of installed equipment is much lower than efficiency of currently available equipment					
h.8 (39)	Retrofit - Pumping distribution method					
	<ul> <li>Current pumping distribution system is inefficient, and could be optimized.</li> <li>Pump distribution loop can be converted from primary to primary-secondary)</li> </ul>					
h.9 (40)	Retrofit - Energy / Heat Recovery					
	<ul> <li>Energy is not recouped from the exhaust air.</li> <li>Identification of equipment with higher effectiveness than the current equipment.</li> </ul>					
h.10 (41)	Retrofit - System (custom)					
	Efficiency of installed system is much lower than efficiency of another type of system					
h.11 (42)	Retrofit - Efficient lighting					
-	Efficiency of installed lamps, ballasts or fixtures are much lower than efficiency of currently available lamps, ballasts or fixtures.					

h.12 (43)	Retrofit - Building Envelope					
	Insulation is missing or insufficient					
	Window glazing is inadequate					
	Too much air leakage into / out of the building					
	Mechanical systems operate during unoccupied periods in extreme weather					
h.13 (44)	Retrofit - Alternative Energy					
	Alternative energy strategies, such as passive/active solar, wind, ground sheltered construction or other alternative, can be incorporated into the building design					
h.14 (45)	OTHER Retrofit					
	Please contact PBEEEP Project Engineer for approval					
i.1 (46)	Differed Maintenance from Recommended/Standard					
	Differed maintenance that results in sub-optimal energy performance.					
	• Examples: Scale buildup on heat exchanger, broken linkages to control actuator missing equipment components, etc.					
i.2 (47)	Impurity/Contamination					
112 (47)	<u> </u>					
	<ul> <li>Impurities or contamination of operating fluids that result in sub-optimal performance. Examples include lack of chemical treatment to hot/cold water systems that result in elevated levels of TDS which affect energy efficiency.</li> </ul>					
i.3 ( )	Leaky/Stuck Damper					
	The outside or return air damper on an AHU is leaking or is not modulating causing the energy use go up because of additional load to the central heating and/or cooling plant.					
i.4 ( )	Leaky/Stuck Valve					
	The heating or cooling coil valve on an AHU is leaking or is not modulating causing the energy use go up because of additional load to the central heating and/or cooling plant.					
i.5 (48)	OTHER Maintenance					
	Please contact PBEEEP Project Engineer for approval					
j.1 (49)	OTHER					
	Please contact PBEEEP Project Engineer for approval					



# **Findings Summary**

# Building: Elmer Anderson Office Building

Site: Elmer Anderson

Eco #	Investigation Finding	Total Cost	Savings	Payback	Co- Funding	Payback Co-Funding	GHG
5	AHU-3 Operates 24/7	\$3,630	\$6,377	0.57	\$0	0.57	66
7	Fan Powered VAV minimum CFM setpoints are the same as the maximums.	\$11,660	\$7,138	1.63	\$0	1.63	104
8	Building Chilled water pump operating during outside air conditions below 55F.	\$1,540	\$492	3.13	\$0	3.13	7
9	Space heating is excessive.	\$3,080	\$954	3.23	\$0	3.23	3
2	AHU Economizers not functioning as designed.	\$27,500	\$7,249	3.79	\$0	3.79	22
4	Toilet exhaust fan operates beyond normal hours of occupancy.	\$880	\$135	6.53	\$0	6.53	2
1	AHU Supply Fan not maintaining duct static pressure setpoint.	\$23,650	\$2,673	8.85	\$0	8.85	29
	Total for Findings with Payback 3 years or less:		\$13,515	1.13	\$0	1.13	169
	Total for all Findings:	\$71,940	\$25,017	2.88	\$0	2.88	233







### Building: Elmer Anderson Office Building

FWB Number:	11801		Eco Number:	1	
Site:	Elmer Anderson		Date/Time Created:	5/30/2012	
Investigation Finding:	AHU Supply Fan not maintaining duct pressure setpoint.	static	Date Identified:	12/20/2010	
Description of Finding:	The supply fan VFD remains at or nea 99% speed, duct static 0.1", duct stati	r 100% spec c SP 1.3". T	ed and cannot achieve his applies to AHU-1,	the supply duct static pressure setpoir AHU-2, AHU-5, AHU-6, AHU-7, AHU-8,	nt. Fan is at and AHU-9.
Equipment or System(s):	AHU with heating and cooling		Finding Category:	Controls (Setpoint Changes)	
Finding Type:	Fan Speed Doesn't Vary Sufficiently				
Implementer:	Controls Contractor		Benefits:	Electric savings, Heating savings, Chil savings and improved occupant comfo	
Baseline Documentation Method:	Trending of AHU supply fan speeds, vi AHU's react to floor plenum pressure		ion and Functional Tes	sting of AHU-2 to determine how it and t	he similar
Measure:	Change supply fan control from duct p				
Recommendation for Implementation:	pressure sensor is not wired such that sensor to communicate with the autom duct pressure sensor and connecting correct sensor for measuring low diffe materials is Part Number: PR-274-R2 plenum pressure sensor measures the tubing for the space may be disconned color once operational check the conditional identity, then recalibrate. If faulty, respeed based on the supply plenum proriginal floor plenum design of 0.04"-Cheating season when occupants have provided by fan powered VAVs.   Tepressure setpoint and by manipulating their own floor diffusers to obtain the document of the perimeter value.	tit is communation system them to the prential press -mA and read differential code from the on and calibbe place the seesure instead. Closed their st and verify the floor differential esired space verall averages will be proventioned.	nicating with the buildin. (It may be possible blenum pressure sensoures. (The Honeywell day a Pressure Differe of the floor plenum vs. a duct pressure senso ration of the existing floor duct pressure. The ad of duct pressure. The floor diffusers the plere proper operation of the users. Provide traite temperature. In the case of 50%. During the iding most of the space.	<u> </u>	am pressure sed for the sor is the bill of ch that the ne existing are sensor.) ut of oll supply fan e set at the ng the heating is sum to adjust fusers will ted to be
Evidence of Implementation Method:	Trending of AHU supply fan motors sp for a duration of at least 3 weeks. Fun pressure.	eeds, floor p ctionally test	lenum pressures, and the new control strate	setpoints at an interval of 15 minutes o gy and verify fan modulation based on f	r less and loor plenum
Annual Electric Savi Estimated Annual kV				y-Chilled Water Savings (kBtu): nergy-Chilled Water Savings (\$):	10,990 \$231
	gy-Hot Water Savings (Gallons): nergy-Hot Water Savings (\$):		Contractor Cost (\$): PBEEEP Provider C Total Estimated Imple	ost for Implementation Assistance (\$): ementation Cost (\$):	\$17,413 \$6,237 \$23,650
Estimated Annual To Initial Simple Paybac Simple Payback w/ I GHG Avoided in U.S	ck (years): Utility Co-Funding (years): . Tons (C02e):	8.85 8.85 29	Utility Co-Funding for Utility Co-Funding for Utility Co-Funding for Utility Co-Funding - E	tkW (\$): therms (\$): stimated Total (\$):	\$0 \$0 \$0 \$0
	Current Pro	pject as Per	centage of Total pro	ject	



Percent Savings (Costs basis)



10.7% Percent of Implementation Costs:

32.9%

Date: 5/30/2012

Page 2



### Building: Elmer Anderson Office Building

FWB Number:	11801		Eco Number:	2	
Site:	Elmer Anderson		Date/Time Created:	5/30/2012	
Investigation Finding:	AHU Economizers not functioning as o	designed.	Date Identified:	12/20/2010	
Description of Finding:	seasons of trending the RA and OA er OA enthalpy points are overridden to o	nthalpy senso constant valu	or readings are not cha es and do not allow th	Illy control the economizer function. Duri anging as outside conditions change. T be economizer to function optimally. OA on The AHU-1, AHU-2, AHU-3, AHU-5, AHU-6	he RA and dampers
Equipment or System(s):	AHU with heating and cooling		Finding Category:	Economizer/Outside Air Loads	
Finding Type:	Economizer Operation - Inadequate F optimized)	ree Cooling	(Damper failed in min	nimum or closed position, economizer so	etpoints not
Implementer:	Controls Contractor		Benefits:	District hot water and chilled water savincreased Economizer efficiency.	ings due to
Baseline Documentation Method:	Trending of OA enthalpy, RA enthalpy,	and OA dam	per position.		
Measure:	Release enthalpy overrides allowing e temperature.	conomizer to	o operate as designed	d. Control economizers to AHU dischard	ger air
Recommendation for Implementation:	1. Release enthalpy overrides. 2. Cha to DAT setpoint. 4. Calibrate OA and F			erature limit from 65F to 70F. 3. Control ors.	economizer
Evidence of Implementation Method:	Trending of outside, return, and exhaut fan speeds, at an interval of 15 minute			OAT, RA Enthalpy, and OA Enthalpy, suppart 3 weeks.	oly/return
	gy-Chilled Water Savings (kBtu): nergy-Chilled Water Savings (\$):		Contractor Cost (\$): PBEEEP Provider C Total Estimated Imple	Cost for Implementation Assistance (\$): ementation Cost (\$):	\$22,154 \$5,346 \$27,500
Estimated Annual To	tal Savings (\$):	\$7,249	Utility Co-Funding for	r kWh (\$):	\$0
Initial Simple Payback (years):		3.79	Utility Co-Funding for	r kW (\$):	\$0
GHG Avoided in U.S	Jtility Co-Funding (years): . Tons (C02e):		Utility Co-Funding for Utility Co-Funding - E		\$0 \$0
		-	centage of Total pro		
Percent Savings (Co	osts basis)	29.0%	Percent of Implement	tation Costs:	38.2%







### Building: Elmer Anderson Office Building

FWB Number:	11801	Eco Number:	4		
Site:	Elmer Anderson	Date/Time Created:	5/30/2012		
			•		
Investigation Finding:	Toilet exhaust fan operates beyond normal hours of occupancy.	Date Identified:	2/1/2012		
Description of Finding:	Trending shows the toilet exhaust is active from 5: occupancy schedule.	00-23:00. The toilet ex	chaust schedule should match the building	J	
Equipment or System(s):	Other	Finding Category:	Equipment Scheduling and Enabling		
Finding Type:	Time of Day enabling is excessive				
Implementer:	In-House Staff	Benefits:	Reduced electric usage by fan.		
Baseline Documentation Method:	Trending of EF3 and EF4 speed.				
Measure:	Change EF schedule to 6:00-18:00.				
Recommendation for Implementation:	Change operating schedule for EF-3 and EF-4 to	6:00-18:00 M-F			
Evidence of Implementation Method:	Trending of EF3 and EF4 status/speed at an inter that the exhaust fans are operating according to the		ss and record for a minimum of 2 weeks.	Ensure	
Annual Electric Savii Estimated Annual kV		Contractor Cost (\$): PBEEEP Provider C Total Estimated Imple	Cost for Implementation Assistance (\$): ementation Cost (\$):	\$583 \$297 \$880	
-		_			
Estimated Annual To		Utility Co-Funding for		\$0	
Initial Simple Payback		Utility Co-Funding for Utility Co-Funding for		\$0 \$0	
GHG Avoided in U.S		Utility Co-Funding - E		\$0 \$0	
	, 1	, ,	V		
	Current Project as Per	centage of Total pro	ject		
D 10 : (0		5		4.00/	

Current Project as Percentage of Total project					
Percent Savings (Costs basis)	0.5%	Percent of Implementation Costs:	1.2%		







# Building: Elmer Anderson Office Building

FWB Number:	11801	Eco Number:	5		
Site:	Elmer Anderson	Date/Time Created:	5/30/2012		
Investigation Finding:	AHU-3 Operates 24/7	Date Identified:	2/1/2012		
Description of Finding:	Trending shows AHU-3 operates 24/7 during all seasons. This is likely to provide conditioning to electrical rooms and data closets. All VAVs which are not critical spaces should go to a minimum flow of 0 CFM during unoccupied times.				
Equipment or System(s):	AHU with heating and cooling	Finding Category:	Equipment Scheduling and Enabling		
Finding Type:	Time of Day enabling is excessive				

Implementer:	Controls Contractor	Benefits:	Reduced electric, district hot/chilled water usage.	
Baseline Documentation Method:	Trending of AHU-3 fan operation.			
Measure:	Implement an unoccupied mode for AHU-3.			
for Implementation:	Program occupancy schedule for all VAVs supplied by AHU-3. Critical spaces to remain occupied 24/7. Verify with owner which VAVs can be reduced to a minimum flow of 0 cfm during unoccupied hours and have them scheduled according to building occupancy. When this unoccupied mode is active the AHU minimum outside air CFM shall be set to 0.			
Evidence of Implementation Method:	Trending of AHU-3 SF status, OA damper position record for a minimum of 3 weeks. Verify that the O appropriate and VAV boxes serving noncritical spa	A damper goes to min	imum position when economizing is not	

Annual Electric Savings (kWh):	67,889	Annual District Energy-Chilled Water Savings (kBtu):	93,721
Estimated Annual kWh Savings (\$):	\$3,999	Est Annual District Energy-Chilled Water Savings (\$):	\$1,968
Annual District Energy-Hot Water Savings (Gallons):	18,625	Contractor Cost (\$):	\$3,036
Est Annual District Energy-Hot Water Savings (\$):	\$410	PBEEEP Provider Cost for Implementation Assistance (\$):	\$594
		Total Estimated Implementation Cost (\$):	\$3,630

Estimated Annual Total Savings (\$):	\$6,377	Utility Co-Funding for kWh (\$):	\$0
Initial Simple Payback (years):	0.57	Utility Co-Funding for kW (\$):	\$0
Simple Payback w/ Utility Co-Funding (years):	0.57	Utility Co-Funding for therms (\$):	\$0
GHG Avoided in U.S. Tons (C02e):	66	Utility Co-Funding - Estimated Total (\$):	\$0

Current Project as Percentage of Total project					
Percent Savings (Costs basis)	25.5% Percent of Implementation Costs:	5.0%			







### Building: Elmer Anderson Office Building

FWB Number:	11801		Eco Number:	7		
Site:	Elmer Anderson		Date/Time Created:	d: 5/30/2012		
	•					
Investigation Finding:	Fan Powered VAV minimum CFM setpothe same as the maximums.	oints are	Date Identified:	2/1/2012		
Description of Finding:	Fan powered VAV minimum airflow setti fans to modulate up and down based on airflow setpoints could be changed to 60 applies to the VAVs served by AHU-1, 2	n the space 0% of the n	temperature condition temperature condition temperature condition and the temperature condition	ons and end up overheating spaces. The	minimum	
Equipment or System(s):	VAV terminal unit		Finding Category:	Controls (Setpoint Changes)		
Finding Type:	Fan Speed Doesn't Vary Sufficiently					
Implementer:	Controls Contractor		Benefits:	Reduced air demand on the AHUs which wi in slower supply fan speeds and reduce ele consumption.		
Baseline Documentation Method:	Trending of AHU return air temperatures design drawings contain FPVAV schedu				anical	
Measure:	Change minimum VAV airflow setting to	60% of ma	aximum airflow setpoi	int.		
Recommendation for Implementation:	For fan powered VAVs, where the minim minimum setpoint to 60% (adj.) of the m sequence will remain. Commission VAV	aximum. T	he fan modulation as	described in the existing Honeywell as-		
Evidence of Implementation Method:	Trending of OAT, space temps, and AHL duration of 3 weeks during the heating s		ds. Trending interval to	o be 15 minutes or less and have a mini	mum	
A	(1)(1)	404 400	0 1 1 0 1(\$)		<b>#0.004</b>	
Annual Electric Savi Estimated Annual kV			Contractor Cost (\$): PBEEEP Provider C Total Estimated Imple	Cost for Implementation Assistance (\$): ementation Cost (\$):	\$9,284 \$2,376 \$11,660	
_						
Estimated Annual To			Utility Co-Funding for kWh (\$):		\$0 \$0	
Initial Simple Payback (years): Simple Payback w/ Utility Co-Funding (years):			3 Utility Co-Funding for kW (\$): 3 Utility Co-Funding for therms (\$):			
GHG Avoided in U.S			Utility Co-Funding - E		\$0 \$0	
D 10 1 10			centage of Total pro	-	40.007	
Percent Savings (Co	osts basis)	28.5%	Percent of Implemen	itation Costs:	16.2%	







### Building: Elmer Anderson Office Building

FWB Number:	11801		Eco Number:	8		
Site:	Elmer Anderson		Date/Time Created:	5/30/2012		
					_	
Investigation Finding:	Building Chilled water pump operating outside air conditions below 55F.	gduring	Date Identified:	2/1/2012		
Description of Finding:	no cooling should be required. Trendir conditions. AHU-10 conditions the loa	ng also show ding dock ar	s all AHU, except AHU nd should not require o	are active down to 30F. At these outdoo J-10, cooling valves to be closed during cooling during these times. The Chilled chilled water pumps should not be active	these OA water pump	
Equipment or System(s):	Pump, primary CHW (evap-only)		Finding Category:	Equipment Scheduling and Enabling		
Finding Type:	Equipment is enabled regardless of n	eed, or such	enabling is excessive			
Implementer:	Controls Contractor		Benefits:	Reduced pump run-hours and electrici	ty usage.	
Baseline Documentation Method:	Trending of building CHW pump spee	ds and AHU	cooling valve position	s.		
Measure:	Change Building Chilled water pump s	sequence so	the pumps are off who	en OAT is below 55F.		
Recommendation for Implementation:	Program chilled water pumps to activa	ate only wher	outside air temperatu	ures are above 55F.		
Evidence of Implementation Method:				Frending to occur during a shoulder sea al to be 15 minutes or less and record		
		<b>.</b>			1	
Annual Electric Savir Estimated Annual kW			9   Contractor Cost (\$): 2   PBEEEP Provider Cost for Implementation Assistance (\$): Total Estimated Implementation Cost (\$):		\$1,243 \$297 \$1,540	
Estimated Annual Total Savings (\$): Initial Simple Payback (years): Simple Payback w/ Utility Co-Funding (years): GHG Avoided in U.S. Tons (C02e):		3.13 3.13	92 Utility Co-Funding for kWh (\$): 13 Utility Co-Funding for kW (\$): 13 Utility Co-Funding for therms (\$): 7 Utility Co-Funding - Estimated Total (\$):		\$0 \$0 \$0 \$0	

C	urrent Project as Percentage of Total project	
Percent Savings (Costs basis)	2.0% Percent of Implementation Costs:	2 1%







### Building: Elmer Anderson Office Building

FWB Number:	11801		Eco Number:	9		
Site:	Elmer Anderson		Date/Time Created:	: 5/30/2012		
Investigation Finding:	Space heating is excessive.		Date Identified:	2/1/2012		
Description of Finding:				ng season range from 73-76F. To be co i. It is recommended that the space setp		
Equipment or System(s):	AHU with heating and cooling		Finding Category:	Controls (Setpoint Changes)		
Finding Type:	Other_Controls (Setpoint Changes)					
					_	
Implementer:	In-House Staff		Benefits:	Reduced HW consumption.		
Baseline Documentation Method:	Trending of all AHU return air tempera	tures and sp	ace temperature data	loggers during the heating season.		
Measure:	Change space temperature setpoints	for the AHUs	and fan powered VA	Vs to 70F during the heating season.		
Recommendation for Implementation:	Change space temperature setpoint to	o 70F (adj.) i	n heating mode only.	This applies to all occupied spaces.		
Evidence of Implementation Method:	Trending of space temperatures and A for a minimum of 2 weeks during the h			ending interval to be 15 minutes or less ce setpoint is maintained.	and record	
	yy-Hot Water Savings (Gallons): nergy-Hot Water Savings (\$):		Contractor Cost (\$): PBEEEP Provider C Total Estimated Imple	cost for Implementation Assistance (\$): ementation Cost (\$):	\$2,486 \$594 \$3,080	
			1		\$0	
Estimated Annual Tot			4 Utility Co-Funding for kWh (\$):			
Initial Simple Payback	k (years): Jtility Co-Funding (years):		3 Utility Co-Funding for kW (\$): 3 Utility Co-Funding for therms (\$):			
GHG Avoided in U.S.			B Utility Co-Funding - Estimated Total (\$):			
	,	•				

Current Project as Percentage of Total project			
Percent Savings (Costs basis)	3.8% Percent of Implementation Costs:	4.3%	







### **Deleted Findings Summary**

# Building: Elmer Anderson Office Building

Site: Elmer Anderson

Eco #	Investigation Finding		Savings	Payback	Co- Funding	Payback Co-Funding	GHG
3	3 AHU-4 Simultaneous heating and cooling: not found in QA		\$0	0.00	\$0	0.00	0
6	6 Heating valves operating during unoccupied hours: payback > 15 yrs		\$0	0.00	\$0	0.00	0
	Total for Findings with Payback 3 years or less:	\$0	\$0	0.00	\$0	0.00	0
	Total for all Findings:	\$0	\$0	0.00	\$0	0.00	0





### **Deleted Findings Details**



### Building: Elmer Anderson Office Building

FWB Number:	11801	Eco Number:	3			
Site:	Elmer Anderson	Date/Time Created:	5/30/2012			
Investigation Finding:	AHU-4 Simultaneous heating and cooling: not found in QA	Date Identified:	2/1/2012			
Description of Finding:	Trending shows both the heating and cooling valves open during outside air conditions of 45F-60F. CEE reviewed the trend data for AHU-4 and found that although both the heating and cooling valves were open simultaneously, one was always open less than 5%. Eliminating the times when both valves are open such a small amount will lead to little or no energy savings and this measure has been deleted by PBEEEP.					
Equipment or System(s):	AHU with heating and cooling	Finding Category:	Deleted			
Finding Type:	Finding Deleted by PBEEEP					

Implementer:	Controls Contractor	Benefits:	Reduced district hot water and chilled water use.				
Baseline Documentation Method:	Trending of heating and cooling valves shows both open during outdoor temperatures from 45F-60F						
Measure:	Provide heating/cooling mode programming which does not allow both valves to be open at once. Estimated savings of ,155 kBtu of Chilled Water and 27,716 kBtu of Hot Water. Estimated Contractor Cost of \$1,276 and PBEEEP Provider Cost of \$594.						
Recommendation for Implementation:	Provide controls programming to allow only one va either a heating or cooling mode and modulating or	live to be open at a tire only the appropriate va	ne. Based on DAT setpoint the AHU should be in alve to maintain the DAT setpoint.				
Evidence of Implementation Method:	Trending of AHU-4 heating and cooling valve posit 45F-60F. The trending interval to be 15 minutes or		The trending must occur during outside air temps of g for a minimum of 3 weeks.				

Estimated Annual Total Savings (\$):	\$0 Utility Co-Funding for kWh (\$):	\$0
Initial Simple Payback (years):	0.00 Utility Co-Funding for kW (\$):	\$0
Simple Payback w/ Utility Co-Funding (years):	0.00 Utility Co-Funding for therms (\$):	\$0
GHG Avoided in U.S. Tons (C02e):	0 Utility Co-Funding - Estimated Total (\$):	\$0

Current Project as Percentage of Total project					
Percent Savings (Costs basis)	0.0% Percent of Implementation Costs:	0.0%			





# **Deleted Findings Details**



# Building: Elmer Anderson Office Building

FWB Number:	11801	Eco Number:	6		
	11.00				
Site:	Elmer Anderson	Date/Time Created:	5/30/2012		
Investigation Finding:	Heating valves operating during unoccupied hours: payback > 15 yrs	Date Identified:	2/1/2012		
Description of Finding:	Trending of the AHU heating valves shows that AHUs 1, 2, 5, 7, and 10 heating valves are fully open during unoccupied hours and the units are off. Valves are likely open as a freeze protection strategy. The AHUs already have freeze-stats and MAT sensors. These should open the valve when temperatures inside the unit are too low. At this point the valves simply open fully when the unit turns off. Sebesta calculated pump and heating savings for this measure. It is likely that the pump savings will occur, but heating savings will not because although heat is lost through the HW pipe system, it will go into the conditioned space. When CEE removed the heating savings from this measure, the payback went well above 15 years and so this measure was deleted by PBEEEP.				
Equipment or System(s):	AHU with heating and cooling	Finding Category:	Deleted		
Finding Type:	Finding Deleted by PBEEEP				
Implementer:	Controls Contractor	Benefits:	Reduced pump run-hours and electricity usage. Reduced HHW usage due to standby loss in piping and heating coils.		
Baseline Documentation Method:	Trending of AHU heating valves and HHW pump operation.				
Measure:	Utilize MAT and freeze-stat sensors for unoccupied freeze protection. Estimated savings of 2,943 kWh and 198,954 kBtu of Hot Water. Estimated Contractor Cost of \$10,912 and PBEEEP Provider Cost of \$1,188.				
Recommendation for Implementation:	Reprogram heating valves to be closed during unoccupied times. Provide programming for when a freeze-stat trips the heating valves will be commanded fully open. Add mixed air temperature sensor to hot deck mixed air sections. Also provide a low mixed air temperature, for all mixed air sections (40F adj.) alarm which when tripped the heating valve is commanded fully open. Commission both freeze-stats, and the new low mixed air temperature alarm sequence.				
Evidence of Implementation Method:	Trending of OAT, MAT, freeze-stat alarms and heating valve position. Trending interval to be 15 minutes or less for a minimum duration of 3 weeks. Functionally test freeze protection safeties and provide written/signed documentation proving the described safeties are in place and operational.				

Estimated Annual Total Savings (\$):	\$0	Utility Co-Funding for kWh (\$):	\$0
Initial Simple Payback (years):	0.00	Utility Co-Funding for kW (\$):	\$0
Simple Payback w/ Utility Co-Funding (years):	0.00	Utility Co-Funding for therms (\$):	\$0
GHG Avoided in U.S. Tons (C02e):	0	Utility Co-Funding - Estimated Total (\$):	\$0

Current Project as Percentage of Total project					
Percent Savings (Costs basis)	0.0%	Percent of Implementation Costs:	0.0%		







#### **Public Buildings Enhanced Energy Efficiency Program**

#### SCREENING RESULTS FOR ELMER L. ANDERSEN HUMAN SERVICES BUILDING

June 9, 2010







#### **Summary Table**

Facility Name	Elmer L. Andersen Human Services Building
Location	540 Cedar Street, St. Paul, MN 55101
Facility Manager	Gene Peterman
Number of Buildings	1
Interior Square Footage	395,752
Parking Ramp Square Footage	231,599
PBEEEP Provider	CEE (Angela Vreeland)
State's Project Manager	Chris Guevin
RECS Project Number	02657ASD
Date Visited	June 4, 2010
Annual Energy Cost	\$1,058,293 (2009)
Utility Company	Xcel Energy (Electric and Natural Gas), District Energy St. Paul (Hot and Chilled Water)
Site Energy Use Index (EUI)	127.5 kBtu/ft <sup>2</sup> (2009)
Benchmark EUI (from B3)	114.5 KBtu/ft <sup>2</sup>

#### Recommendation for Investigation

A full investigation of the Elmer L. Andersen Human Services Building and attached parking ramp is recommended.

<b>Building Name</b>	State ID	Square Footage	Year Built
Andersen Human Services Building	G02310273	395,752	2005
Andersen Parking Ramp		231,599	2005



#### Elmer L. Andersen Human Services Building Screening Overview

The goal of screening is to select buildings where an in-depth energy investigation can be performed to identify energy savings opportunities that will generate savings with a relatively fast (1 to 5 years) and certain payback. The screening of the Elmer L. Andersen Human Services Building (Andersen Office Building) was performed by the Center for Energy and Environment (CEE) with the assistance of the facility staff. This report is the result of that information.

The Andersen Office Building is one large detached building consisting of 395,752 interior square feet. The building has nine stories above ground and one below. The conditioned spaces are primarily offices and there is a data center on the basement level. Levels 5 and 6 and Levels 7 and 8 have open staircases between them while the rest of the floors are closed off to one another. The building has an attached seven story unconditioned parking ramp. The building was constructed in 2005 and was commissioned at the time of construction.

The building runs on a Honeywell EBI R310.1 automation system, which is part of the State Capitol Complex system. All equipment is DDC and all equipment is on the automation system except several Cabinet Unit Heaters, Unit Heaters, and pumps.

The building uses chilled and hot water from District Energy St. Paul. Some of the District chilled water is routed directly to the air handling units (AHUs) and some is run through heat exchangers that send chilled water to Computer Room Air Conditioning (CRAC) units in the data center. The District hot water is run through heat exchangers and the hot water is sent to the air handlers and terminal equipment. There are two natural gas steam boilers that are used solely for humidification in the air handlers.

There are a total of ten AHUs serving the Andersen Office Building. Nine of the AHUs are located in the Penthouse (Level 9) and are variable air volume units with VAV boxes and/or Fan-Powered VAV (FPVAV) boxes. There is one constant volume air handler located on the first floor (Level 1) that serves the loading dock area. Levels 0 (the below ground level) and 1 have VAV boxes in the ceiling plenums. Levels 2-8 have underfloor supply plenums with perimeter FPVAVs. There are round floor diffusers that can be adjusted to supply varying amounts of air to the spaces directly from the underfloor supply plenum. There are also FPVAVs on these floors that are ducted to diffusers along the exterior walls. The FPVAVs take air from the underfloor supply plenum and heat it as needed based on thermostats along the exterior walls. The occupants have no control over the space temperature except for adjusting the amount of air coming out of the round floor diffusers. Level 9 is the Penthouse and is heated by eleven fan coil units.

The attached parking ramp is unconditioned with the exception of the stairwells and elevator lobbies, which are heated by small unit heaters and fan coil units. The first and second floors of the ramp have large ducted exhaust fans that control to CO and CO<sub>2</sub>. The remaining floors of the ramp (Levels 3-7) are more open to the outside and do not have exhaust fans.



The facility just recently had a lighting study performed which includes energy saving recommendations; this study will be a source of measures to be considered for implementation under PBEEEP.

There is one natural gas meter, one electric meter, two District Energy (St. Paul) meters (one for chilled water and one for hot water), and one fuel oil meter. Fuel oil is used only by the back-up generator.

A full energy investigation of the Andersen Office Building is recommended. Although the building is only five years old and was commissioned, the building has a higher than expected Energy Use Intensity (EUI). The EUI of the building is 11% higher than the B3 benchmark, which indicates that there are opportunities for reducing energy use, although it was designed under a code intended to produce a building that used 30% less energy than this benchmark. In addition, the building is fully automated, which increases the likelihood that energy reduction measures can be implemented cost-effectively.



This screening report is based on the PBEEEP Guidelines. It is based on one site visit, review of the facility documentation, building automation system, a limited inspection of the facility and interviews with the staff. The purpose of the screening report is to evaluate the potential of the facility for the implementation of cost-effective energy efficiency savings through recommissioning. To the best of our knowledge the information here is accurate. It provides a high level view of many, but by no means all, of the important parameters of the mechanical equipment in the facility. Because it is the result of a limited audit survey of the facility, it may not be completely accurate.

Andersen Office Building		State ID# G02310273				
Area (sqft)	395,752	Year Built	2005	Occupancy (hrs/yr)	3,510	
HVAC Equipme	HVAC Equipment					
• 10 AHUs	• 10 AHUs					
NAME	SIZE	TYPE	NOTES			
AHU 1	40,000 CFM	VAV	VFDs or	n SF and RF, Single-zone w	ith Hot and	
	75 hp SF, 20 hp 1	RF	Cold De	ck, Serves VAV boxes on L	evels 6 and 7	
AHU 2	40,000 CFM	VAV	VFDs or	n SF and RF, Single-zone w	ith Hot and	
	75 hp SF, 20 hp l			Cold Deck, Serves VAV boxes on Level 8		
AHU 3	34,000 CFM	VAV	VFDs or	s SE and RE Single-zone S	erves VAV	
Ario 3	75 hp SF, 20 hp l		VFDs on SF and RF, Single-zone, Serves VAV boxes on Levels 0-8			
A 1111 4			VIED	ar the at the a	*****	
AHU 4	34,000 CFM 75 hp SF, 15 hp l	VAV	boxes or	n SF and RF, Single-zone, S	erves VAV	
	75 np 51, 15 np 1	KI	DOACS OF	I LCVCI I		
AHU 5	44,000 CFM	VAV		n SF and RF, Single-zone w		
	100 hp SF, 20 hp	RF	Cold De	ck, Serves VAV boxes on L	evels 2 and 3	
AHU 6	40,000 CFM	VAV	VFDs or	n SF and RF, Single-zone w	ith Hot and	
	75 hp SF, 20 hp l	RF	Cold De	ck, Serves VAV boxes on L	evels 4 and 5	
AHU 7	40,000 CFM	VAV	VFDs or	n SF and RF, Single-zone w	ith Hot and	
	75 hp SF, 20 hp l			ck, Serves VAV boxes on L		
AHU 8	40,000 CFM	VAV	VEDs or	n SF and RF, Single-zone w	ith Hot and	
Anus	75 hp SF, 20 hp l			ck, Serves VAV boxes on L		
				·		
AHU 9	44,000 CFM	VAV		n SF and RF, Single-zone w ck, Serves VAV boxes on L		
	100 hp SF, 20 hp	Kr	Cola De	ck, serves v A v doxes on L	evels 2 alia 3	
AHU 10	4,000 CFM	Constant	U	one, Face/Bypass, Serves th	e loading	
	5 hp SF	Volume	dock are	a on Level 1		



#### **HVAC** Equipment- Continued

- 112 Variable Air Volume (VAV) Boxes: Ratings between 110 and 2,630 CFM, most have HW reheat
- 294 Fan Powered VAV Boxes (FPVAV): Ratings of 520 or 575 CFM, most have HW reheat
- 13 Fan Coil Units (FCU): Ratings between 1,600 and 5,000 cfm
- 12 Computer Room Air Conditioning (CRAC) Units: Ratings between 13.5 and 20 Tons
- **2 Steam Boilers:** Used for humidification in AHUs, low-pressure steam, natural gas, 1,176 kBtu/hr output each.
- 24 Pumps
  - 5 CHW Pumps: All variable volume with VFDs, 3 for the Data Center (7.5hp each), 2 for the AHUs (50hp each)
  - o 2 HW Pumps: Both variable volume with VFDs, 25hp each
  - o 3 Boiler Feed Pumps: All constant volume, 1/3hp each
  - o 2 Circulating Pumps: Both constant volume, 1/6hp each
  - o 3 Condensate Pumps: All constant volume, (1) 1/3hp, (2) 1/5hp
  - o 3 Domestic Booster Pumps: All constant volume, (1) 1.5hp, (2) 7.5hp
  - o 2 Fuel Oil Pumps: Both constant volume, 1/4hp each
  - o 4 Sump Pumps: All constant volume, (2) 1/2hp, (2) 3/4 hp
- 7 Cabinet Unit Heaters: Ratings between 800 and 1,500 CFM
- **18 Unit Heaters**: Ratings between 380 and 2,700 CFM
- 8 Heat Exchangers: 4 for CHW to the Data Center, 3 for HW, 1 for Boiler Feed Water
- **7 Exhaust Fans**: Ratings between 750 to 12,380 CFM
- 3 Stairwell Pressurization Fans: 8,000 CFM each
- 15 Supply Fans: Used during generator operation, 9,000 cfm each
- 2 Air Compressors: Used during generator operation, 7.5hp each
- **1 Back-up Generator:** 1,250 kW output



#### Points on BAS

- AHUs 1-2, 5-9 Points: RAT, RA CO2, RA CO2 setpoint, RF status, RF CFM, EA damper, Hot deck damper, Cold deck damper, OA damper, MAT before cooling coil, Heat valve, Cool valve, DA RH, SF status, SF CFM, DA DSP, DA RH, DAT, Occupancy, Max space temp, DAT setpoint, Econ mode limits
- AHU 3-4 Points: Return damper, RA RH, RA CO2, RA CO2 setpoint, RAT, RF status, RF CFM, MA damper, MAT, MAT setpoint, Heat valve, Cool valve, DA RH, SF status, SF CFM, DA DSP, DAT, Supply damper, Occupancy, Max space temp, DAT reset parameters
- **AHU 10 Points**: RAT, MA damper, MAT, Face Bypass damper, Heat valve, Cool valve, SF status, DAT, DA DSP, Occupancy, Room temp
- VAV Points: Summer mode setpoint, Winter mode setpoint, Setpoint offset, Summer Winter Mode, Setpoint, Room temp, Reheat CFM, CFM setpoint, Max CFM, Min CFM, HW valve
- **FPVAV Points**: Room temp, Room setpoint, Reheat valve, Fan speed, Fan status (cool/heat)
- FCU Points: Room temp, Room setpoint, Reheat valve, Cooling valve, Fan status
- **CRAC Unit Points**: Room temp, Room RH
- **Boiler Points**: Boiler system enable, Lead boiler, Steam pressure, Valve to make-up water exchanger, Steam temp
- CHW System Points: Pump status, Pump speed, AHU CHWST, AHU CHWRT, AHU CHW DP, Data center CHWST, Data Center CHWRT, Data center CHW DP, Data center CHWS GPM, Data center supply/return temp difference
- **EF Points**: EF status, EA DSP (EFs 3 and 4 only)
- Stairwell Pressurization Fan Points: Fan status, Damper position, Stairwell DP, Stairwell DP setpoint

#### Capabilities of BAS

- The BAS is fully capable of trending. The Plant Management Division (PMD) of the Department of Administration controls the BAS.
- There are 24,000 points available for trending.
- PMD will set up all trending required for the project based on the direction of the provider.
- The trend data will be exported in a standard format such as csv.



Andersen Parking Ramp					
Area (sqft)	231,599	Year Built	2005	Occupancy (hrs/yr)	N/A

#### **HVAC** Equipment

- 2 Exhaust Fans: Both rated at 16,000 CFM
- 7 Fan Coil Units (FCU): All rated at 300 CFM
- 4 Unit Heaters: All rated at 380 CFM

#### Points on BAS

- FCU Points: Room temp, Room setpoint, Reheat valve, Cooling valve, Fan status
- **EF Points**: EF status

#### Capabilities of BAS

• See Andersen Office Building for details

#### Additional comments by building staff

- The VAV boxes operate at a reduced airflow during unoccupied hours.
- There is a lighting control system, but little information is known about it.
- All HVAC equipment is original to the building when it was built in 2005.
- The most common occupant complaint is that it is too cold in the spaces, even during the summer.



PBEEEP Abbreviation Descriptions				
AHU	Air Handling Unit	HP	Horsepower	
BAS	Building Automation System	HRU	Heat Recovery Unit	
CD	Cold Deck	HW	Hot Water	
CDW	Condenser Water	HWDP	Hot Water Differential Pressure	
CDWRT	Condenser Water Return Temperature	HWRT	Hot Water Return Temperature	
CDWST	Condenser Water Supply Temperature	HWST	Hot Water Supply Temperature	
CFM	Cubic Feet per Minute	kW	Kilowatt	
CHW	Chilled Water	kWh	Kilowatt-hour	
CHWRT	Chilled Water Return Temperature	MA	Mixed Air	
CHWDP	Chilled Water Differential Pressure	MA Enth	Mixed Air Enthalpy	
CHWST	Chilled Water Supply Temperature	MARH	Mixed Air Relative Humidity	
CRAC	Computer Room Air Conditioner	MAT	Mixed Air Temperature	
CV	Constant Volume	MAU	Make-up Air Unit	
DA	Discharge Air	OA	Outside Air	
DA Enth	Discharge Air Enthalpy	OA Enth	Outside Air Enthalpy	
DARH	Discharge Air Relative Humidity	OARH	Outside Air Relative Humidity	
DAT	Discharge Air Temperature	OAT	Outside Air Temperature	
DDC	Direct Digital Control	Occ	Occupied	
DP	Differential Pressure	PTAC	Packaged Terminal Air Conditioner	
DSP	Duct Static Pressure	RA	Return Air	
DX	Direct Expansion	RA Enth	Return Air Enthalpy	
EA	Exhaust Air	RARH	Return Air Relative Humidity	
EAT	Exhaust Air Temperature	RAT	Return Air Temperature	
Econ	Economizer	RF	Return Fan	
EF	Exhaust Fan	RH	Relative Humidity	
Enth	Enthalpy	RTU	Rooftop Unit	
ERU	Energy Recovery Unit	SF	Supply Fan	
FCU	Fan Coil Unit	Unocc	Unoccupied	
FPVAV	Fan Powered VAV	VAV	Variable Air Volume	
FTR	Fin Tube Radiation	VFD	Variable Frequency Drive	
GPM	Gallons per Minute	VIGV	Variable Inlet Guide Vanes	
HD	Hot Deck			

#### **Conversions:**

1 kWh = 3.412 kBtu

1 Therm = 100 kBtu

1 kBtu/hr = 1 MBH

